

# Manhole Inspection Summary

Manhole # S01U\_\_013MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **01U** Node: **013** Status: **Found**

Insp Date: **6/4/08 1:01 PM**

Incomplete Comments

Crew: **KA.BC.JD**  
Inspector: **Chung**  
Firm: **URS**

**Location** Address: **4733 MELBOURNE RD.**

Cross Street: **BRISBANE RD**

**Manhole** Type: **Inline** Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **DEBRIS IN THE FLOW CHANNEL**

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Closed** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**


**Steps** Count: **7** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View

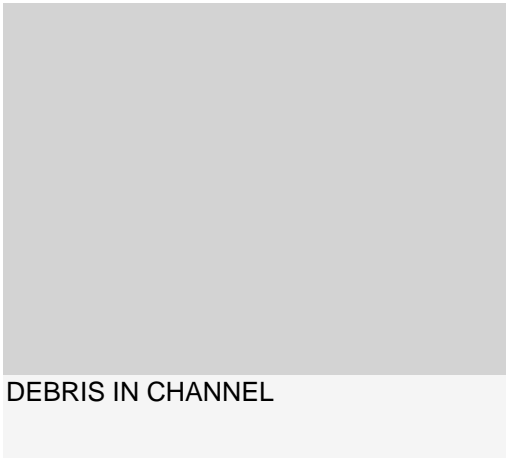

GRADE ADJUSTMENT

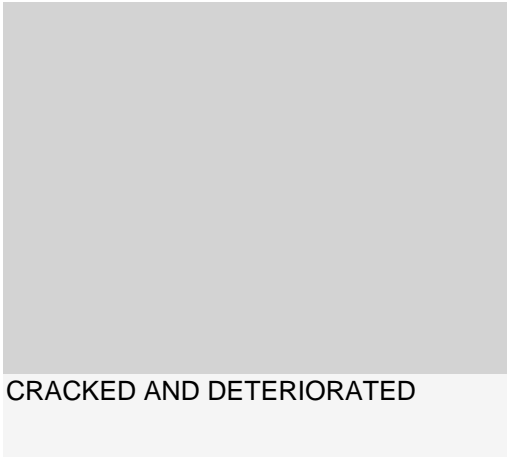

## Manhole Inspection Summary

Manhole # S01U\_\_013MH

Printed On: 6/24/2010

Page 3 of 4

10 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.30** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease

Silt Depth: **10** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.20** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **5** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary


Manhole # S01U\_\_013MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer  
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **13.00** (ft.) Flow Characteristics: **None**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**  
☐ Possible Illicit Connection